

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No. 1558-1
Description Business Mailing List
Model Model I
Stock No. 26-1558 Version 1.0
Date October 13, 1980
Page 1 of 1

Problem

There have been several reports that listings and labels printed in ZIP CODE order would be printed out of sequence after updating any zip code. The changes below should keep the problem from occurring.

Solution

To correct a disk on which the problem has already occurred you will need to make the program changes, then delete and reenter any items printed out of sequence.

1. Backup your diskette(s) and make the following changes on the Backup diskette.
2. In BASIC load the program by typing LOAD"MLS".
3. Make the following corrections.

LINE CHANGES (Retype the entire line or refer to the Edit section of your owners manual)

Old Line: 830 GOSUB2980:PRINT@64,"SELECT LINE TO BE UPDATED --> ";

New Line: 830 PA=N1: GOSUB2980:PRINT@64,"SELECT LINE TO BE UPDATED --> ";

Old Line: 1090 GOSUB2050:IFCF<>0THEN640ELSE1130

New Line: 1090 GOSUB2050: P7=640: IFCF<>0THEN640ELSE1130

Old Line: 1130 GOSUB1870:GOSUB2190:GOTO640

New Line: 1130 GOSUB1870: IFPA<>N1THEN530ELSE GOSUB2190:GOTO640

4. Type SAVE"MLS" to save the changes in the program.
5. At TRSDOS Ready, make a backup of your corrected diskette.