

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	<u>1590-03</u>
Description	<u>SuperSCRIPSIT</u>
Model	<u>Model III</u>
Stock No.	<u>26-1590 Vers. 01.02.01</u>
Date	<u>August 31, 1983</u>
Page 1 of	<u>1</u>

Problem

Multiple copies of some lines when printing very long documents.

* * THE FOLLOWING PATCHES ARE REQUIRED! * *

Solution

The following patch will correct the problem for newly typed documents only! Documents previously created before applying this patch will not be corrected.

PATCH SCRIPSIT/CMD (ADD=7C7A, FIND=6D, CHG=71)

Apply the following patch for the version number change:

PATCH SCR17/CTL (ADD=8EC7, FIND=31, CHG=32)

After patches from this Bulletin have been applied, the version number will be 01.02.02. Please make the necessary entry in your Version Log.