CUSTOMER SERVICE BULLETIN

Radio Shaek CUSTOMER SERVICE BULLETIN

Bulletin No.	4512- Ø 7
	PROFILE II
Model	MODEL II
Stock No.	26-4512 Vers. Ø1.Ø1.ØØ
Date	May 27, 1983
Page 1 of	2
_	

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Problem

Several problems have occured with PROFILE II as itemized.

- 1. Does not restore proper forms settings upon exit from LABEL.
- Any field over 99 fields is useless. Program appears to allow more than 99 fields.
- 3. Not selecting correctly for merge if there is an initial blank record.
- * * THE FOLLOWING PATCHES ARE REQUIRED! * *

Solution

To restore forms settings upon exit from LABEL, apply the following patches:

To patch PRINT to retain proper forms settings, apply the following patches:

```
PATCH PRINT/EFC A=5DF2 F=ØØØØØØØØØØØØØØØØØØØ C=Ø6ØØ3E5FCFED43Ø35E
PATCH PRINT/EFC A=5DFB F=ØØØØØØØØØØØØØØØ C=ED53Ø55E21ØØ3CC9
PATCH PRINT/EFC A=5EØ7 F=ØØØØØØØØØØØØØØ C=ED4BØ35EED5BØ55E
PATCH PRINT/EFC A=5EØF F=ØØØØØØØØØØØØ C=3E11CFC3425D
PATCH PRINT/EFC A=4A24 F=21ØØ3C C=CDF25D
PATCH PRINT/EFC A=51BA F=CD425D C=CDØ75E
```

To patch CREATE to stop entry of more than 99 fields, apply the following patches:

(Continued on page 2)

CUSTOMER SERVICE BULLETIN

Subject ______ PROFILE II 4512-Ø7

Page ____2 Of ___2

PATCH CREATE/EFC A=4A1F F=2Ø2Ø2Ø2Ø2Ø2Ø2Ø2Ø2Ø2Ø2Ø C=2AE9467DFE64D2F853 PATCH CREATE/EFC A=4A28 F=2Ø2Ø2Ø C=C33A53 PATCH CREATE/EFC A=5337 F=2AE946 C=C31F4A

To fix SELECTOR to handle initial blank records, apply the following patches:

Apply the following patch to update the version number.

PATCH M A=3912 F=" " C="Ø1.Ø1.Ø1"

After patches from this Bulletin have been applied, the version number will be $\emptyset 1. \emptyset 1. \emptyset 1$. Please make the necessary entry in your Version Log.