CUSTOMER SERVICE BULLETIN

Radio Shaek

4515-Ø5 Builetin No.

PROFILE PLUS **Description**

Model

Model II

Stock No.

26-4515 Version 1.Ø

Date

Sept. 15, 1982

Page 1 of

400 Atrium-One Tandy Center, Fort Worth, Texas 76102

Problem

It is possible to encounter misadded totals in columnar data on reports after experiencing a DØ (divide by zero), or /OV (field overflow) error.

THESE PATCHES ARE REQUIRED!

Solution

To avoid the above problem, at TRSDOS READY apply the following patches to your PROFILE PLUS Master Diskette.

PATCH PRINT/EFC A=36A4 F=D63ØED6F C=CD155EØØ

PATCH PRINT/EFC A=36AB F=D63ØED6F C=CD155EØØ

PATCH PRINT/EFC A=5Elf F=ØØØØØØØØØØØØØØ C=3E3ØD63ØED6FC9