

# CUSTOMER SERVICE BULLETIN

## Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	4517-04
Description	PROFILE PLUS UPGRADE
Model	MODEL II
Stock No.	26-4517 Vers. 01.01.01
Date	May 31, 1983
Page 1 of	2

### Problem

Several problems have occurred with PROFILE PLUS UPGRADE as itemized.

1. Does not restore proper forms settings upon exit from LABEL.
2. Any field over 99 fields is useless. Program appears to allow more than 99 fields.
3. Labels not printing properly if the first field in a line does not contain data and the second field uses the < symbol (push left) in define labels. The second field will print to the left on the platen.

\* \* THE FOLLOWING PATCHES ARE REQUIRED! \* \*

### Solution

Apply the following patches AFTER upgrading.

To restore forms settings upon exit from LABEL, apply the following patches:

```
PATCH LABEL/EFC A=6048 F=0000000000000000 C=21003CC34C4C
PATCH LABEL/EFC A=604E F=00000000000000000000 C=06003E5FCFED435F60
PATCH LABEL/EFC A=6057 F=00000000000000000000 C=ED53616021003CC9
PATCH LABEL/EFC A=6063 F=00000000000000000000 C=ED4B5F60ED5B6160
PATCH LABEL/EFC A=606B F=0000000000000000 C=3E11CFC3B65F
PATCH LABEL/EFC A=4C49 F=21003C C=CD4E60
PATCH LABEL/EFC A=553A F=CDB65F C=CD6360
PATCH LABEL/EFC A=558B F=CAF64B C=CA4860
PATCH LABEL/EFC A=4DE0 F=CAF64B C=CA4860
```

To patch print to retain proper forms settings, apply the following patches:

```
PATCH PRINT/EFC A=5DF2 F=00000000000000000000 C=06003E5FCFED43035E
PATCH PRINT/EFC A=5DFB F=00000000000000000000 C=ED53055E21003CC9
PATCH PRINT/EFC A=5E07 F=00000000000000000000 C=ED4B035EED5B055E
PATCH PRINT/EFC A=5E0F F=0000000000000000 C=3E11CFC3425D
PATCH PRINT/EFC A=4A24 F=21003C C=CDF25D
PATCH PRINT/EFC A=51BA F=CD425D C=CD075E
```

(Continued on page 2)

# CUSTOMER SERVICE BULLETIN

PROFILE PLUS UPGRADE 4517-04

2

2

Subject \_\_\_\_\_

Page \_\_\_\_\_

Of \_\_\_\_\_

To patch create to stop entry of more than 99 fields, apply the following patches:

```
PATCH CREATE/EFC A=4A28 F=20202020202020202020 C=2AEB467DFE64D29E54
PATCH CREATE/EFC A=4A31 F=202020 C=C3E053
PATCH CREATE/EFC A=53DD F=2AEB46 C=C3284A
```

Apply the following patches to fix a push-left problem in LABEL.

```
PATCH LABEL/EFC A=6071 F=000000000000000000000000 C=E511826319110000ED4B
PATCH LABEL/EFC A=607B F=000000000000000000000000 C=70447EFE2ACA9B60FE3F
PATCH LABEL/EFC A=6085 F=000000000000000000000000 C=CA9B60FE3CCA9B60FE40
PATCH LABEL/EFC A=608F F=000000000000000000000000 C=CA9B60231305C27D6011
PATCH LABEL/EFC A=6099 F=000000000000000000000000 C=00002A6D4419D119D1EB
PATCH LABEL/EFC A=60A3 F=000000 C=C3DB40
PATCH LABEL/EFC A=40D8 F=19D1EB C=C37160
```

Apply the following patch to update the version number.

```
PATCH M A=3995 F="01.01.01" C="01.01.02"
```

After patches from this Bulletin have been applied, the version number will be 01.01.02. Please make the necessary entry in your Version Log.