

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	4530-5 (Correction)
Description	Scripsit
Model	Model II
Stock No.	26-4530 Version 1.0a
Date	April 8, 1981
Page 1 of	1

Problem

The printer is not pausing between pages. This happens particularly when merging documents. If the customer has already checked his print menu and made sure there is a Y for the question "PAUSE BETWEEN PAGES?" insert the following patches

Solution

1. Reset the system at SWAP diskettes
2. Answer the Date Prompt
3. Press HOLD and press <ENTER> for the Time Prompt
4. Type in the following patches at TRSDOS Ready, pressing an <ENTER> after each one.

PATCH SCRIPSIT A=C40F F=FD210390 C=C380DB00

PATCH SCRIPSIT A=DB80 F=0000000000000000 C=E521FFFF2242BDE1

PATCH SCRIPSIT A=DB88 F=0000000000000000 C=FD210390C313C4

5. Type STARTUP and press <ENTER>
6. Scripsit is now patched and you can continue operation.
7. Make a backup of the corrected diskette.