## **CUSTOMER SERVICE BULLETIN**

<b>Radio Shaek</b> ®	
CUSTOMER	
SERVICE	
BULLETIN	

Bulletin No	4531–1Ø
Description	
Model	Model II
Stock No.	26-4531 Version 2.Ø
Date	June 7, 1982
Page 1 of	1
<u> </u>	

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

## **Problem**

Three problems have been found with Scripsit 2.0. They are:

1) Scripsit will hang if you try to edit a word that will not fit in the margins.

2) If a user defined print code contains a space, the space will not be underlined via the normal SCRIPSIT underline mode.

3) As noted on page 28, paragraph g. of the SCRIPSIT Reference Manual, Scripsit will print only one copy of a document when doing a merge printout. To allow multiple copies, apply the following patches.

## **Solution**

Apply these patches to correct the above problems.

1) BE SURE THE DATE AT THE BOTTOM OF THE STARTUP SCREEN IS 05/27/1982. IF NOT, BE SURE TO OBTAIN AND DO ALL PREVIOUS PATCHES.

PATCH SCRIPSIT A=9F68 F=6Ø C=5E

2) PATCH SCRIPSIT A=D61B F=21 C=2Ø

After applying these patches, apply the following to change the date in the startup screen to 06/02/1982.

PATCH STARTUP A=E4ØE F=BØB5AFB2B7 C=BØB6AFBØB2