

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	4703-1
Description	COBOL Compiler
Model	Model II
Stock No.	26-4703 Version 1.2
Date	March 5, 1981
Page 1 of	1

Problem

Binary data in ISAM key fields causes loop in COBOL. This is an unusual programming practice but can be allowed with following patches.

Solution

Put in the following patches at TRSDOS Ready pressing <ENTER> after each patch.

```
PATCH RUNCOBOL A=502A F=FA31503E01 C=CDE0830000
```

```
PATCH RUNCOBOL A=83E0 F=00000000000000000000 C=2B963E01D03E04C9
```