

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	4703-2
Description	COBOL Compiler
Model	Model II
Stock No.	26-4703 Version 1.2
Date	March 5, 1981
Page 1 of	1

Problem

Executing RUNCOBOL from a DO file allows operator the freedom to press BREAK at any time. If ISAM file indexes are being updated, pressing BREAK will destroy the file so that it is unusable. To disallow this possibility, use the following patch.

Solution

Type in the following patch at TRSDOS Ready followed by an <ENTER>.

```
PATCH RUNCOBOL A=7077 F=CD C=CC
```

This patch prevents RUNCOBOL from being executed in a DO file.