

# CUSTOMER SERVICE BULLETIN

## Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

<b>Bulletin No.</b>	4713-Ø1
<b>Description</b>	EDITOR ASSEMBLER
<b>Model</b>	MODEL II
<b>Stock No.</b>	26-4713 SERIES I
<b>Date</b>	Nov. 12, 1981
<b>Page 1 of</b>	1

### Problem

The OTDR instruction assembles improperly with the Series I Editor Assembler.

### Solution

The reference book used for checking the assembler, had a typographical error which caused the mistake. OTDR should assemble as "EDBB". The Series I package assembles "ED8B" instead.

To correct the problem, apply the following patch to your EDTASM program:

```
PATCH EDTASM A=4E3Ø F=8B C=BB
```

Users who wish to correct the comment line in the SAMPLE/SCR should change ;ED8B to ;EDBB.