CUSTOMER SERVICE BULLETIN

Radio Shack

Bulletin No. 4715-Ø1

Description BI-SYNC. COMM.

Model Model II

Stock No. 26-4715 Version 1.Ø

Date Nov. 16, 1981

Page 1 of

400 Atrium-One Tandy Center, Fort Worth, Texas 76102

Problem

The following patches corrects the polling problem with the Bi-Sync package. The problem is characterized by slow response to Model II input.

Solution

- 1) At TRSDOS READY apply these patches to a backup copy of 4715 PATCH BIS327Ø A=DC15,F=ØØØØØØØØØØØØØØØØØØØØØØØØ.C=3AB192FEØØC83ACD92C35D7A PATCH BIS327Ø A=7A5A,F=3ACD92,C=C315DC
- 2) You are now ready to continue use of 4715.