

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	4716-01
Description	Bi-Sync. Comm.
Model	Model II
Stock No.	26-4716 Version 1.0
Date	Nov. 16, 1981
Page 1 of	1

Problem

The following patches corrects the duplicate ACK problem with 26-4716 package. The problem is characterized by duplicate print lines, duplicate disk data, or high retransmission rates.

Solution

1) At TRSDOS READY apply the following patches to a backup copy of the program diskette.

PATCH BIS3780 A=7CEE,F=00000000000000000000000000000000 C=AF324A813E00326481C36350

PATCH BIS3780 A=505E,F=3E00326481,C=C3EE7C0000

2) You can now continue to use BI-SYNC (4716)