

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	4831-05
Description	SCRIPSIT HD
Model	Model II/12/16
Stock No.	26-4831 Vers. 01.00.04
Date	September 27, 1983
Page 1 of	1

Problem

Acquisition of more than 31 documents causes erratic behavior.

* * THE FOLLOWING PATCHES ARE REQUIRED! * *

Solution

Apply the following patches to correct the problem.

```
PATCH SCRIPSIT/SYS R=4 B=250 F=320140 C=CD21DB
PATCH SCRIPSIT/CMD A=DB21 F=202020202020 C=320140E52103
PATCH SCRIPSIT/CMD A=DB27 F=202020202020 C=40CBAE7EE1C9
```

Apply the following patch to change the version number to 01.00.05.

```
PATCH SCRIPSIT A=E2E3 F=34 C=35
```

After patches from this Bulletin have been applied, the version number will be 01.00.05. Please make the necessary entry in your Version Log.