

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	4835-04
Description	SCRIPSIT 3.0
Model	Model 12/16
Stock No.	26-4835 Ver. 03.00.03
Date	September 28, 1983
Page 1 of	1

Problem

Merge function doesn't work with headers and footers nor does it allow for printing multiple copies of a merge.

* * THE FOLLOWING PATCHES ARE REQUIRED! * *

Solution

Apply the following patches to correct the problems.

```
PATCH SCRIPSIT/SYS R=195 B=188 F=22808A C=000000
PATCH SCRIPSIT/SYS R=126 B=175 F=CDE229 C=CD20DB
PATCH SCRIPSIT/SYS R=126 B=237 F=CD252A C=CD27DB
PATCH SCRIPSIT/CMD A=DB20 F=20202020202020 C=AF322690C3E229
PATCH SCRIPSIT/CMD A=DB27 F=20202020202020 C=AF322690C3252A
```

Apply the following patch to update the Version Number to 03.00.04.

```
PATCH SCRIPSIT A=E330 F='3' C='4'
```

After patches from this Bulletin have been applied, the version number will be 03.00.04. Please make the necessary entry in your Version Log.