

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No. 4910-7
Description TRSDOS Top of form
Model Model II
Stock No. 26-4910 Version 2.0
Date October 13, 1980
Page 1 of 1

Problem

TRSDOS 2.0 print software causes Centronics printers to lose top-of-forms alignment when an auto top-of-forms is performed (i.e. - lines printed exceed "L" value from print-initialization). This is also true with some older LP III's. This should be applied to all 2.0 systems.

Solution

The following patch will correct the problem:

```
PATCH SYSRES/SYS A=109D F=C5060CCD2910C1C0 C=060CCD2910C00E00
```

If the machine returns the message "STRING NOT FOUND" the patch has already been applied to your diskette.