CUSTOMER SERVICE BULLETIN

Radio Shaek CUSTOMER SERVICE BULLETIN

Bulletin No. 4912-02 (Correction 1)*

Description TRSDOS II

Model II/12/16

Stock No. 26-4912 Ver. 94.92.99

Date July 20, 1983

Page 1 of 1

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Problem

Errors are occurring after SPOOL followed by a DO filename command. If SPOOL is on, the error 'OPEN ATTEMPT FOR FILE ALREADY OPEN' is returned. If SPOOL is off, the error 'PARAMETER FOR OPEN IS INCORRECT' is returned.

* * THE FOLLOWING PATCHES ARE REQUIRED FOR USE WITH ENHANCED MODEL II/12
AND MODEL 16! * *

Solution

*NOTE: Correction is to version numbers only.

After patches from this Bulletin have been applied, the version number will be $\emptyset4.\emptyset2.\emptyset1$. Please make the necessary entry in your Version Log.

PATCH IFC R=6 B=187 F=214300 C=C38E3C

PATCH IFC R=11 B=135 F=00000000000 C=21C8FC2281FC

PATCH IFC R=11 B=141 F=00000000000 C=21C8FE2283FC

PATCH IFC R=11 B=147 F=ØØØØØØØØØØØØ C=2143ØØC3D937