

CUSTOMER SERVICE BULLETIN

Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	6105-02
Description	TRSDOS 16
Model	Model II/16
Stock No.	26-6040 Version 1.0
Date	November 9, 1982
Page 1 of	1

Problem

The end-of-memory test will take too long, due to large buffer accessed, to determine the end-of-memory test.

The following problems would occur: illegal instruction traps, illegal SVC, loss of memory and faulty memory errors. These errors were more prevalent on machines with 256K or more memory.

* * THE FOLLOWING PATCHES ARE REQUIRED! * *

Solution

To force the high end-of-memory test to use a 2 byte buffer instead of 1K bytes for comparison, apply the following patches at TRSDOS Ready.

```
PATCH BOOT16 A=3124 F=0004 C=0200
PATCH BOOT16 A=3130 F=0004 C=0200
PATCH BOOT16 A=313C F=0004 C=0200
PATCH BOOT16 A=3153 F=0004 C=0200
PATCH BOOT16 A=315F F=0004 C=0200
PATCH BOOT16 A=3176 F=0004 C=0200
PATCH BOOT16 A=3E5C F=0004 C=0200
PATCH BOOT16 A=364F F=00FF C=AA55
```