## **CUSTOMER SERVICE BULLETIN**

## Radio Shack CUSTOMER SERVICE BULLETIN

Bulletin No. 6105-02 (Correction 1)

**Description TRSDOS 16** 

Model Model II/16

Stock No. 26-6105 Vers. 04.01.00

Date February 23, 1983

Page 1 of 1

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

## **Problem**

The end-of-memory test will take too long, due to large buffer accessed, to determine the end-of-memory test.

The following problems would occur: illegal instruction traps, illegal SVC, loss of memory and faulty memory errors. These errors were more prevalent on machines with 256K or more memory.

\* \* THE FOLLOWING PATCHES ARE REQUIRED! \* \*

## Solution

To force the high end-of-memory test to use a 2 byte buffer instead of 1K bytes for comparison, apply the following patches at TRSDOS Ready.

```
PATCH BOOT16 A=3124 F=ØØØ4 C=Ø2ØØ
PATCH BOOT16 A=313Ø F=ØØØ4 C=Ø2ØØ
PATCH BOOT16 A=313C F=ØØØ4 C=Ø2ØØ
PATCH BOOT16 A=3153 F=ØØØ4 C=Ø2ØØ
PATCH BOOT16 A=315F F=ØØØ4 C=Ø2ØØ
PATCH BOOT16 A=3176 F=ØØØ4 C=Ø2ØØ
PATCH BOOT16 A=3E5C F=ØØØ4 C=Ø2ØØ
PATCH BOOT16 A=364F F=ØØFF C=AA55
```